
Smoke and Dye Testing Summary

High Level Sewershed

Run Summa	ry ———						
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-234	Smoke	8/12/2009	ADS/TM	S21MM_013MH	Dry	Yes	946.51

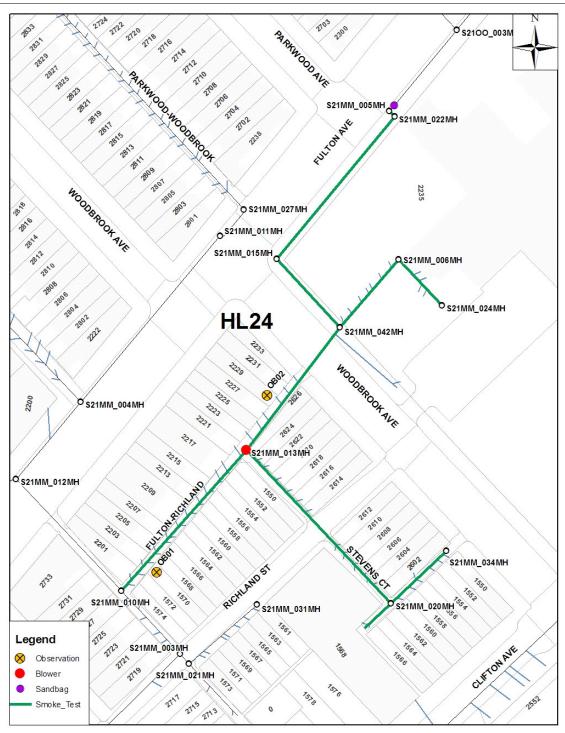

Smoke and Dye Testing Summary

High Level Sewershed

Run Summar	y 						
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-234	Smoke	8/12/2009	ADS/TM	S21MM_013MH	Dry	Yes	946.51

Isolated Pipes

Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)
S21MM_006G1	S21MM_006MH	S21MM_042MH	77.1005	10
S21MM_020G1	S21MM_020MH	S21MM_013MH	180.636	8
S21MM_042G1	S21MM_042MH	S21MM_013MH	132.337	10
S21MM_034G1	S21MM_034MH	S21MM_020MH	65.5321	8
S21MM_013G1	S21MM_013MH	S21MM_010MH	161.282	10
S21MM_005G1	S21MM_005MH	S21MM_022MH	6.52536	10
S21MM_049G1	S21MM_049DE	S21MM_020MH	30.9482	8
S21MM_022G1	S21MM_022MH	S21MM_015MH	158.414	10
S21MM_015G1	S21MM_015MH	S21MM_042MH	79.6723	10
S21MM_024G1	S21MM_024MH	S21MM_006MH	54.0622	8

Observations & Photos

Obs_ID S1028-234-OB01 **Address** 1570 Richland St

Status Private **Source** Cleanout

Location Yard - back **Nearest MH** S21MM_010MH

Comments Smoke from cleanout in back yard. 1570

Richland St.



Picture \S1028-234-OB01-P01.jpg

Comments Back of house, 1570 Richland St.

Obs_ID S1028-234-OB02 **Address** 2229 Fulton Ave

Status Private
Source Cleanout

Location Yard - back **Nearest MH** S21MM_013MH

Comments Smoke from cleanout in back yard. 2229

Fulton Ave.



Picture \S1028-234-OB02-P01.jpg

Comments Back of house, 2229 Fulton Ave.